



Productivity Inc®

Haas DT-1 PRE-INSTALLATION CHECKLIST – Rev 02/2010

Installation of your new Haas DT-1 can be smooth and rapid if preparations are made prior to the delivery of your machine. Any questions regarding machine installation should be directed to our service department for clarification. We hope this checklist will aid in a rapid installation of your new machine. **NOTE: The following must be completed prior to our service technician arriving to install your new machine.**

- Power Requirements for your machine: 230v/3ph/28kVa 100 amps (*460v/3ph/28kVa 50 Amp)
 Proper voltage per machine specifications should be ready at machine site. **Do NOT power up machine. A separate earth ground wire of the same conductor size as the input power must be connected to the chassis of the machine; must be supplied from the main plant ground. A local cold-water pipe or ground rod is not sufficient.**
 *NOTE: 460v requires either an Internal or External Transformer.

*****NOTE: If you have purchased the 1000 psi High Pressure Coolant option, you will need a separate power source. 208-230v/3ph/20 Amp or 480/3ph/10 Amp circuit is needed for the unit. The CNC does NOT provide the power source. Any questions, please contact our Service Department.*****

- Customer should furnish and have available the proper supply and types of lubricants required for machine operation.

ITEM	CAPACITY	FLUID TYPE
Coolant	45 Gal	Water Soluble, synthetic
Way Lube	80 oz.	Mobil Vactra #2

You will need to have Coolant and Lubricants on hand at time of installation. Contact our Service Department for more information or questions.

- Air lines should be routed to the machine location and operational for proper air pressure.

The VMC requires a minimum of 100 PSI at 4 cfm (w/optional AAG Auto Air Gun, 10 scfm) at the input to the pressure regulator on the back of the machine. This should be supplied by at least a 2-HP compressor, with a minimum 20-gal tank, that turns on when the pressure drops to 100 PSI. The air must be supplied through a minimum 3/8" hose and fittings must be at least 1/4" NPT.


- Machine location should be planned to allow enough room for access panels to be opened and serviced with ease. A minimum of 36" clearance around the machine is required for operator and maintenance access.
- Weight requirements should be checked to insure that the surface below the machine will have sufficient strength for support and stability. The machine must be set on a solid, sound and stable, steel bar-reinforced concrete slab poured directly on the grade. In general, the 6" concrete floor on industrial buildings is suitable for machine placement.
- **The Haas DT-1 should be moved with a forklift. Notify Hope immediately if you plan to use a crane. Upon arrival of your machine, uncrate and immediately check for visible damage.**

SHIPPING WEIGHT (skidded/wrapped)	SHIPPING DIMENSIONS OF MACHINE
6,628#	98" L x 87" W x 101" H
<i>See attached for dimensions/floor space requirements. Operational weight 4,200#</i>	

- Remove as much preservative from the machine as possible without having to power up (tables – slides, pulleys, etc.). We recommend mineral spirits to clean. Apply oil when finished to prevent rust.

PLEASE FORWARD THIS TO THE APPROPRIATE PERSON. THANK YOU.

HAAS DT-1 DIMENSIONS/LAYOUT

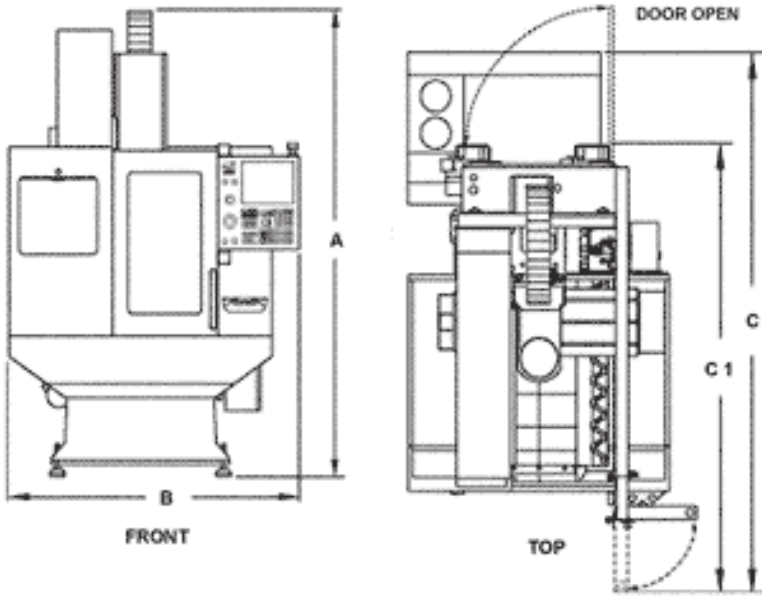

	Mix View	
A	103 " (2646 mm)	
B	68 " (1727 mm)	
C	124 " (3150 mm)	
C 1	100 " (2540 mm)	