



15150 – 25th Avenue North, Minneapolis, MN 55447-1981  
 Phone 763-476-8600 Fax 763-476-4092 Visit us at: [www.productivity.com](http://www.productivity.com)  
 Service Dept: (MN) 763-476-4191 (IA) 319-632-4288 (NE) 402-330-2323  
 Productivity is ISO 9001:2000 Certified

Productivity Inc®

**Okamoto ACC-16.24DX PRE-INSTALLATION CHECKLIST** – Rev 11/2008

Installation of your new Okamoto ACC-16.24DX can be smooth and rapid if preparations are made prior to the delivery of your machine. Any questions regarding machine installation should be directed to our service department for clarification. We hope this checklist will aid in a rapid installation of your new machine. **NOTE: The following must be completed prior to our service technician arriving to install your new machine.**

- Power Requirements for your machine: 230/460v, 3 phase, 7.5 kVa  
 Proper voltage per machine specifications should be ready at machine site. **Do NOT power up the machine.**  
**Note: Machine has dual voltage capabilities. Usually wired to 460v unless otherwise specified.**
- Customer should furnish and have available the proper supply and types of lubricants required for machine operation at the time of installation.

ITEM	CAPACITY	FLUID TYPE
Coolant	1 Gallon	Water Soluble Type
Hydraulic Fluid	32 Gallons	Mobil Vacuoline #1405

*NOTE: You will need to have these fluids on hand at the time of installation.*

- Air lines should be routed to the machine location and operational for proper air pressure.

Not applicable.

- Machine location should be planned to allow enough room for access panels to be opened and serviced with ease. A minimum of 36" clearance around the machine is required for operator and maintenance access.
- Weight requirements should be checked to insure that the surface below the machine will have sufficient strength for support and stability. The machine must be set on a solid, sound and stable, steel bar-reinforced concrete slab poured directly on the grade. In general, the 6" concrete floor on industrial buildings is suitable for machine placement.
- **The Grinder is best moved using a forklift, however, an overhail crane can be used. Contact our Service department for more information. Upon arrival of your machine, uncrate and immediately check for visible damage.**

SHIPPING WEIGHT	SHIPPING DIMENSIONS OF MACHINE
7,100# (DX Version)	(DX Version) 89" L x 89" W x 87" H (machine crated/skidded)
7,500# (DXV version) (machines crated/skidded)	(DXV Version) 92" L x 89" W x 87" W
500# (accessory skid)	4'L x 4'W x 4'H (skidded)
<i>Operational Dimensions: 107"L x 87"W x 70"H (6,160#)</i>	

- Remove as much preservative from the machine as possible without having to power up (tables – slides, pulleys, etc.). We recommend mineral spirits to clean. Apply oil when finished to prevent rust.

**PLEASE FORWARD THIS TO THE APPROPRIATE PERSON. THANK YOU.**